
APPENDIX H

AMBIENT NOISE MEASUREMENT DATA



Noise Measurement Report Form - Part A

Date: 08/25/2022 Day of Week: Thursday Time: 11:58 AM Project Number: 7187

Monitoring Segment / Area: 1 Monitoring Site Address: 12623 Muscatel St

Measurement Taken By: Eric / Michel of UltraSystems Environmental

Average Wind Speed: 3.8 mph [km/hr] Compass Heading (meter 1 to source) 292° W

Temp: 90.3 °F Relative Humidity: 31.2 % Compass Heading (into wind) 250° W

Cloud Cover Class (1 = heavy overcast, 2 = lightly overcast, 3 = sunny) 3

Approximate distance of sound level meter from receptor location: 8 ft

Approximate distance of sound level meter from construction site: _____
(Leave Blank for Baseline Ambient)

Receptor Land Use (Check One): ☒ Residential ☐ Institutional ☐ Comm./Ind. ☐ Recreational

Sound Level Meter: Make and Model: Quest SoundPro DL-1-1/3 Serial Number: BINO30017

Meter Setting: ☒ A-Weighted Sound Level (SLOW) ☐ A-Weighted Sound Level (FAST)

Measurement Start Time: 11:58 AM Measurement End Time: 12:13 PM

Total Measurement Time: 15 min Session File Name (e.g., S012): S272

Check the measurement purpose:

☒ Baseline condition ☐ Ongoing construction ☐ Caltrans ☐ Complaint response

Measurement Results

Measurement Type	Measured Levels (dB)	
Calibration	Pre: <u>114.0</u>	Post: <u>113.9</u>
L _{eq} (h)	Slow: <u>53.1</u>	Fast: _____
L _{max}	Slow: <u>61.1</u>	Fast: _____
L ₉₀	Slow: <u>49.8</u>	Fast: _____

Field Notes:

- Traffic noise from 15 freeway
- Police sirens ~ 45 sec interval
- _____

Noise Monitor's Signature: [Signature] Date: 08/25/2022





Noise Measurement Report Form - Part B

Date: 08/25/2022 Day of Week: Thursday Time: 11:58 AM Project Number: 7127

Monitoring Segment / Area: 1 Monitoring Site Address: 12623 Mustang St.

Site Map

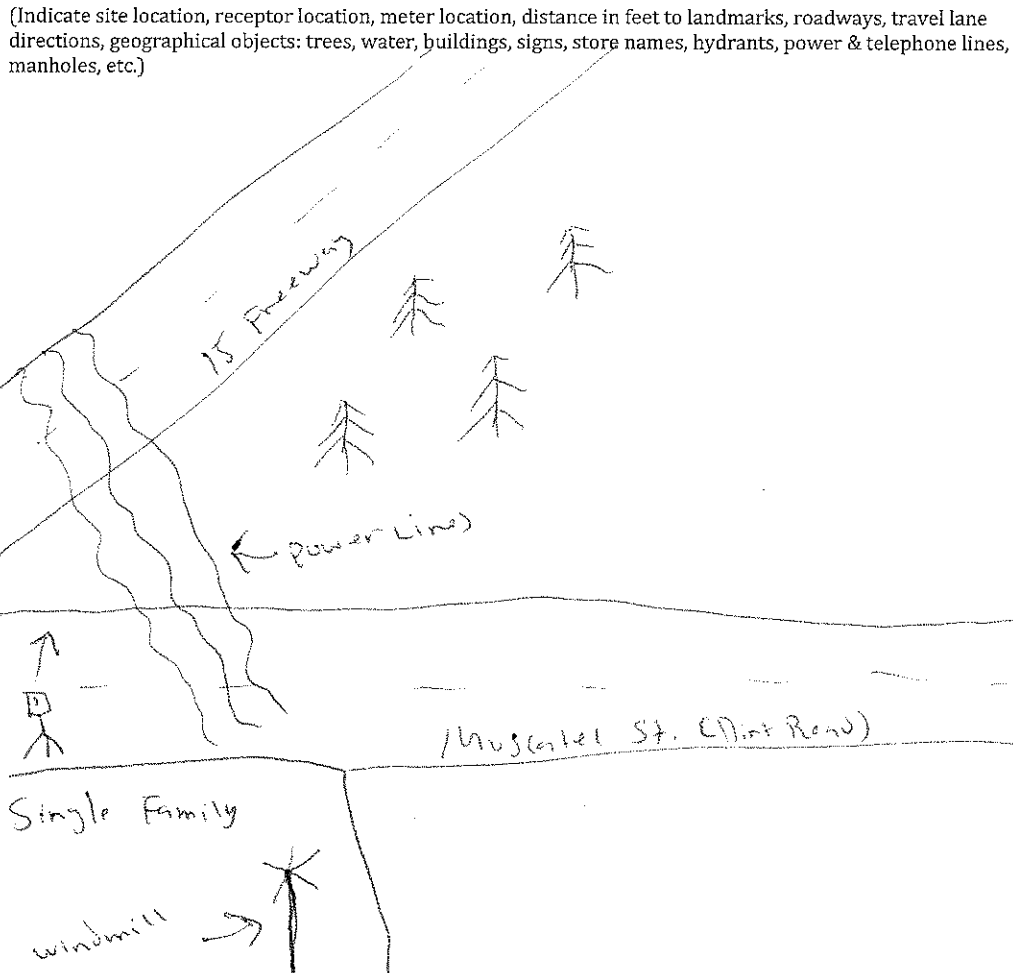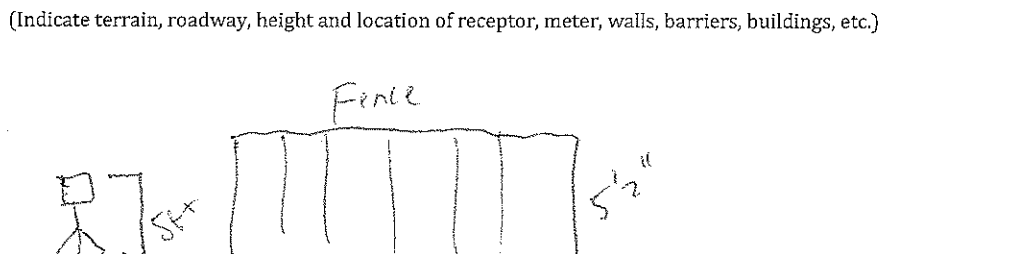Plan View  North Arrow (fill-in)	(Indicate site location, receptor location, meter location, distance in feet to landmarks, roadways, travel lane directions, geographical objects: trees, water, buildings, signs, store names, hydrants, power & telephone lines, manholes, etc.) 	
Elevation View	(Indicate terrain, roadway, height and location of receptor, meter, walls, barriers, buildings, etc.) 	
Latitude: <u>34.412080°</u>	Longitude: <u>-117.387977°</u>	Elevation: <u>3630ft</u>

Noise Monitor's Signature: [Signature] Date: 08/25/2022

Session Report

8/25/2022

Information Panel

Name	S272_BIN030017_25082022_154820
Start Time	8/25/2022 11:57:51 AM
Stop Time	8/25/2022 12:12:51 PM
Device Name	BIN030017
Model Type	SoundPro DL
Device Firmware Rev	R.13F
Comments	

Summary Data Panel

Description	Meter	Value	Description	Meter	Value
Leq	1	53.1 dB	L90	1	49.8 dB
Lmax	1	61.1 dB			
Exchange Rate	1	3 dB	Weighting	1	A
Response	1	SLOW	Bandwidth	1	OFF
Exchange Rate	2	5 dB	Weighting	2	C
Response	2	FAST			


Statistics Table

dB:	0.0	0.1	0.2	0.3	0.4	0.5	0.6	0.7	0.8	0.9	%
45:	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.01	0.01
46:	0.10	0.11	0.14	0.16	0.09	0.05	0.04	0.08	0.06	0.15	1.00
47:	0.18	0.11	0.06	0.04	0.04	0.04	0.11	0.19	0.15	0.10	1.02
48:	0.06	0.14	0.20	0.17	0.33	0.33	0.38	0.59	0.57	0.50	3.28
49:	0.50	0.32	0.41	0.40	0.30	0.43	0.52	0.56	0.71	0.61	4.75
50:	0.55	0.91	1.27	1.10	1.21	1.31	1.20	1.43	1.31	1.22	11.51
51:	1.62	1.86	1.86	1.99	1.50	1.77	1.97	1.99	2.01	1.89	18.47
52:	1.69	1.30	1.23	1.24	1.49	1.44	1.66	1.45	1.67	1.99	15.17
53:	1.90	2.01	2.25	2.14	2.28	1.92	1.59	2.16	2.24	1.95	20.43
54:	1.39	1.24	1.27	1.51	1.52	1.60	1.40	1.20	1.02	0.97	13.12
55:	0.90	0.67	0.56	0.69	0.90	0.74	0.64	0.59	0.52	0.37	6.58
56:	0.23	0.16	0.23	0.30	0.21	0.21	0.16	0.17	0.18	0.22	2.07
57:	0.14	0.10	0.11	0.12	0.13	0.15	0.15	0.13	0.13	0.10	1.24

58:	0.10	0.12	0.06	0.07	0.08	0.09	0.10	0.13	0.05	0.03	0.81
59:	0.02	0.03	0.03	0.02	0.02	0.02	0.02	0.03	0.05	0.02	0.27
60:	0.02	0.02	0.05	0.03	0.01	0.01	0.01	0.01	0.01	0.01	0.19
61:	0.03	0.04	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.07

Statistics Chart

S272_BIN030017_25082022_154820: Statistics Chart

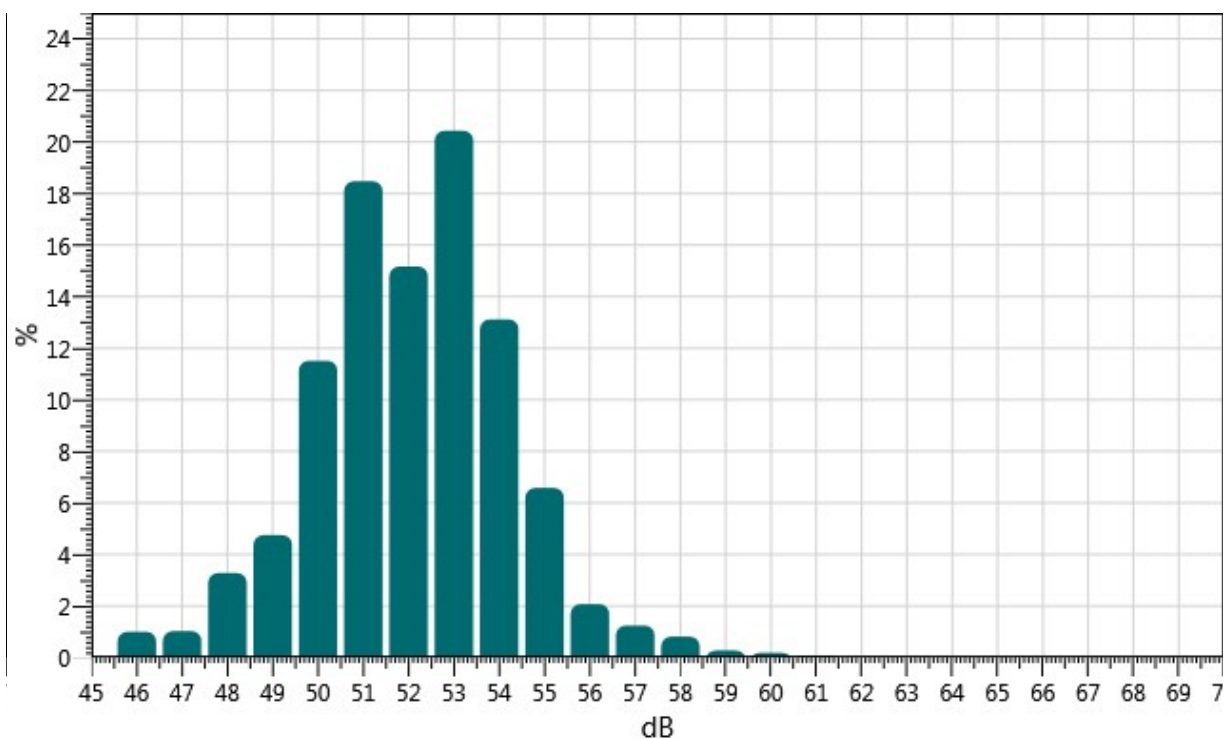


Exceedance Table

.	0%	1%	2%	3%	4%	5%	6%	%7	%8	%9
0%:		58.3	57.4	56.6	56.2	55.8	55.6	55.4	55.3	55.2
10%:	55.0	54.9	54.8	54.7	54.6	54.5	54.4	54.4	54.3	54.2
20%:	54.2	54.1	54.0	53.9	53.9	53.8	53.8	53.7	53.7	53.6
30%:	53.6	53.5	53.5	53.4	53.4	53.3	53.3	53.2	53.2	53.1
40%:	53.1	53.0	53.0	52.9	52.9	52.8	52.8	52.7	52.7	52.6
50%:	52.5	52.5	52.4	52.4	52.3	52.2	52.1	52.0	52.0	51.9
60%:	51.8	51.8	51.7	51.7	51.6	51.6	51.5	51.5	51.4	51.4
70%:	51.3	51.3	51.2	51.2	51.1	51.0	51.0	50.9	50.9	50.8
80%:	50.7	50.6	50.6	50.5	50.4	50.3	50.3	50.2	50.1	50.0
90%:	49.8	49.7	49.5	49.3	49.0	48.8	48.6	48.4	47.8	46.8
100%:	45.8									


Exceedance Chart

S272_BIN030017_25082022_154820: Exceedance Chart

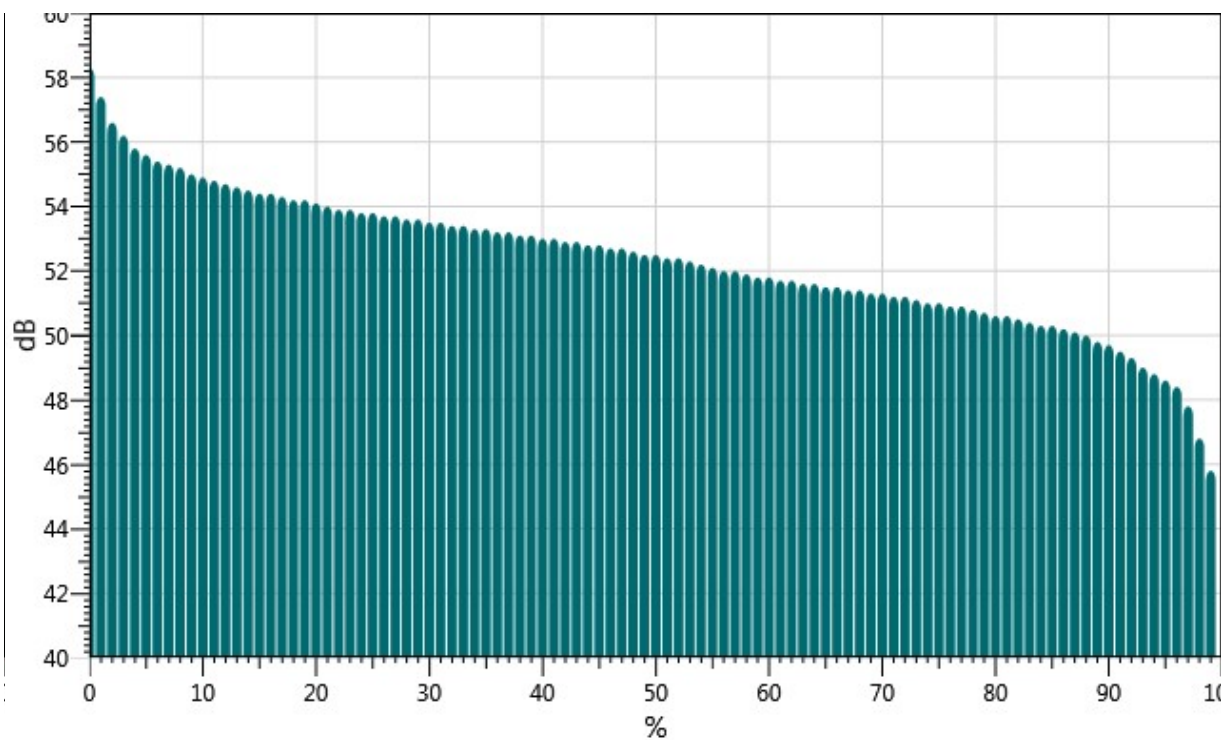

Logged Data Chart

S272_BIN030017_25082022_154820: Logged Data Chart

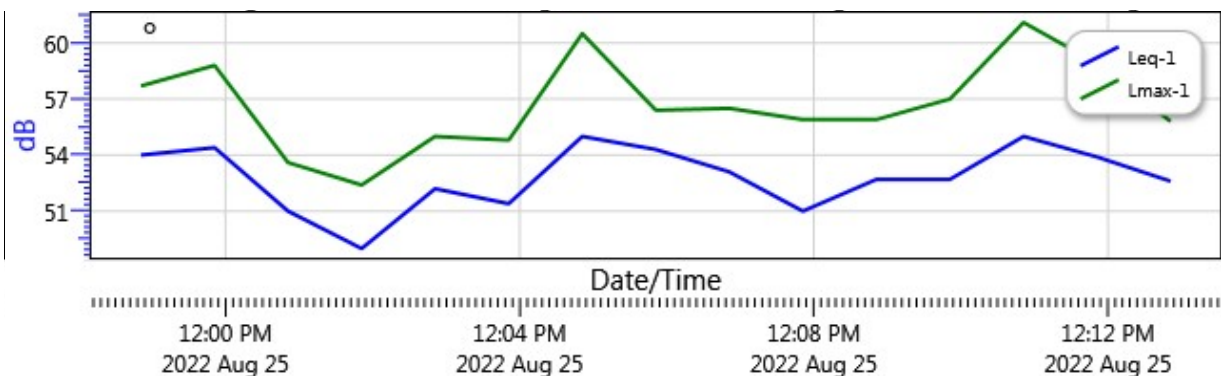



Noise Measurement Report Form - Part A

Date: 08/25/2022 Day of Week: Thursday Time: 10:52 AM Project Number: 7187

Monitoring Segment / Area: 2 Monitoring Site Address: 12850 Muscatel St

Measurement Taken By: Erik / Michael of UltraSystems Environmental

Average Wind Speed: 5.2 mph [km/hr] Compass Heading (meter $\perp$ to source) 275° W

Temp: 88.3 °F Relative Humidity: 31.8 % Compass Heading (into wind) 236° SW

Cloud Cover Class (1 = heavy overcast, 2 = lightly overcast, 3 = sunny) 3

Approximate distance of sound level meter from receptor location: 150 ft

Approximate distance of sound level meter from construction site: _____
(Leave Blank for Baseline Ambient)

Receptor Land Use (Check One): ☐ Residential ☒ Institutional ☐ Comm./Ind. ☐ Recreational

Sound Level Meter: Make and Model: Quest SoundPro DL-1-1/3 Serial Number: BFN030017

Meter Setting: ☒ A-Weighted Sound Level (SLOW) ☐ A-Weighted Sound Level (FAST)

Measurement Start Time: 10:52 AM Measurement End Time: 11:07 AM

Total Measurement Time: 15 min Session File Name (e.g., S012): S270

Check the measurement purpose:

☒ Baseline condition ☐ Ongoing construction ☐ Caltrans ☐ Complaint response

Measurement Results

Measurement Type	Measured Levels (dB)	
Calibration	Pre: <u>114.0</u>	Post: <u>114.2</u>
L_{eq} (h)	Slow: <u>49.8</u>	Fast: _____
L_{max}	Slow: <u>62.6</u>	Fast: _____
L_{90}	Slow: <u>45.7</u>	Fast: _____

Field Notes:

- Traffic noise along Muscatel
- _____
- _____

Noise Monitor's Signature: [Signature]

Date: 08/25/2022





Noise Measurement Report Form - Part B

Date: 08/25/2022 Day of Week: Thursday Time: 10:52 AM Project Number: 7187

Monitoring Segment / Area: 2 Monitoring Site Address: 12850 Muscatel St.

Site Map

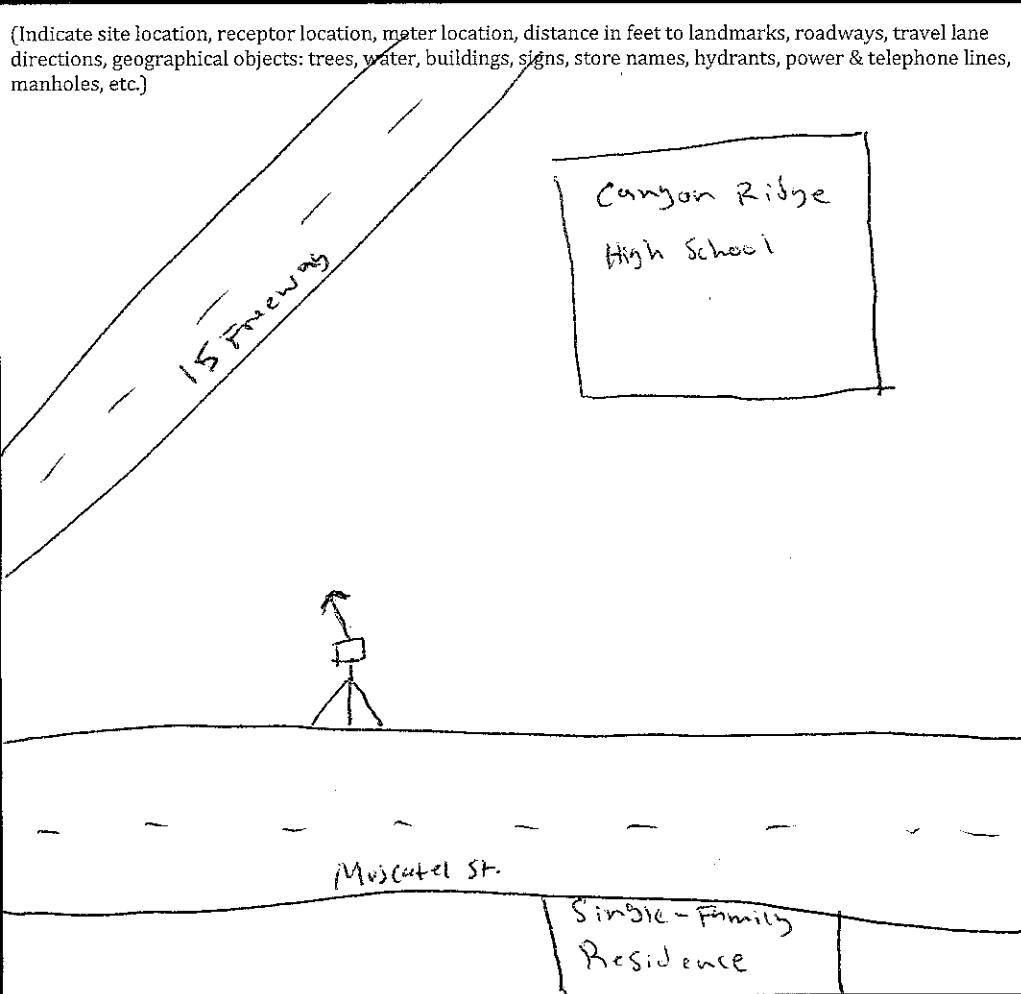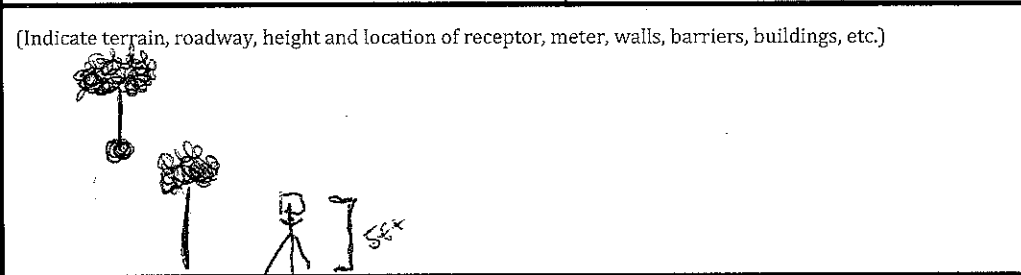Plan View  North Arrow (fill-in)	(Indicate site location, receptor location, meter location, distance in feet to landmarks, roadways, travel lane directions, geographical objects: trees, water, buildings, signs, store names, hydrants, power & telephone lines, manholes, etc.) 	
Elevation View	(Indicate terrain, roadway, height and location of receptor, meter, walls, barriers, buildings, etc.) 	
Latitude: <u>34.412319</u>	Longitude: <u>-117.383736</u>	Elevation: <u>3610 ft</u>

Noise Monitor's Signature: Carlin

Date: 08/25/2022

Session Report

8/25/2022

Information Panel

Name	S270_BIN030017_25082022_154806
Start Time	8/25/2022 10:51:57 AM
Stop Time	8/25/2022 11:06:57 AM
Device Name	BIN030017
Model Type	SoundPro DL
Device Firmware Rev	R.13F
Comments	

Summary Data Panel

Description	Meter	Value	Description	Meter	Value
Leq	1	49.8 dB	L90	1	45.7 dB
Lmax	1	62.6 dB			
Exchange Rate	1	3 dB	Weighting	1	A
Response	1	SLOW	Bandwidth	1	OFF
Exchange Rate	2	5 dB	Weighting	2	C
Response	2	FAST			


Statistics Table

dB:	0.0	0.1	0.2	0.3	0.4	0.5	0.6	0.7	0.8	0.9	%
44:	0.00	0.00	0.00	0.02	0.05	0.07	0.15	0.66	0.68	0.63	2.26
45:	0.79	0.65	0.54	0.64	0.41	0.93	1.32	1.42	1.45	1.55	9.70
46:	1.85	1.32	1.90	1.64	1.35	1.53	1.50	1.32	1.43	1.40	15.24
47:	1.79	1.52	1.57	1.53	1.66	1.36	1.61	2.02	1.86	1.99	16.91
48:	2.24	2.05	1.59	1.63	1.30	1.69	1.92	1.89	2.24	2.48	19.02
49:	2.58	1.59	1.84	1.65	1.73	1.73	1.61	1.81	1.38	0.86	16.78
50:	1.07	1.01	0.97	0.60	0.83	1.11	0.85	0.51	0.51	0.41	7.88
51:	0.39	0.43	0.56	0.65	0.46	0.49	0.53	0.51	0.34	0.26	4.61
52:	0.40	0.24	0.27	0.23	0.25	0.23	0.26	0.25	0.18	0.14	2.46
53:	0.13	0.13	0.23	0.20	0.10	0.10	0.13	0.16	0.15	0.16	1.50
54:	0.07	0.06	0.07	0.06	0.04	0.06	0.13	0.07	0.08	0.07	0.71
55:	0.09	0.07	0.05	0.06	0.08	0.09	0.07	0.03	0.03	0.07	0.64
56:	0.06	0.06	0.06	0.06	0.06	0.03	0.04	0.04	0.05	0.04	0.49

57:	0.03	0.05	0.03	0.03	0.02	0.03	0.03	0.02	0.05	0.04	0.36
58:	0.03	0.03	0.01	0.02	0.03	0.03	0.03	0.04	0.05	0.04	0.32
59:	0.03	0.04	0.02	0.03	0.02	0.02	0.02	0.02	0.02	0.02	0.24
60:	0.02	0.02	0.02	0.02	0.03	0.03	0.03	0.04	0.05	0.04	0.30
61:	0.04	0.05	0.08	0.03	0.02	0.01	0.02	0.02	0.03	0.02	0.33
62:	0.02	0.02	0.02	0.02	0.05	0.10	0.02	0.00	0.00	0.00	0.24

Statistics Chart

S270_BIN030017_25082022_154806: Statistics Chart

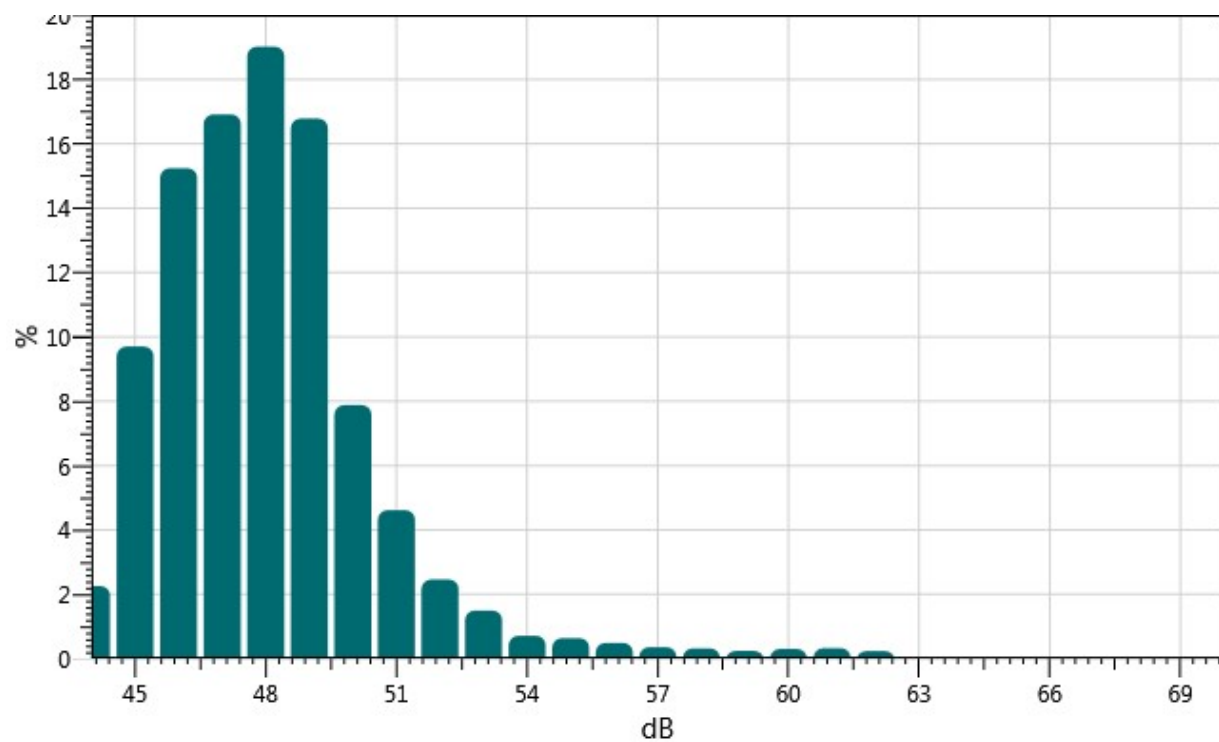


Exceedance Table

.	0%	1%	2%	3%	4%	5%	6%	%7	%8	%9
0%:		59.2	56.3	54.7	53.6	52.9	52.4	52.0	51.7	51.5
10%:	51.3	51.1	50.9	50.7	50.5	50.4	50.3	50.2	50.1	50.0
20%:	49.9	49.7	49.7	49.6	49.6	49.5	49.4	49.4	49.3	49.3
30%:	49.2	49.1	49.1	49.0	49.0	48.9	48.9	48.8	48.8	48.8
40%:	48.7	48.7	48.6	48.6	48.5	48.5	48.4	48.4	48.3	48.2
50%:	48.2	48.1	48.0	48.0	47.9	47.9	47.8	47.8	47.7	47.7
60%:	47.6	47.6	47.5	47.5	47.4	47.3	47.3	47.2	47.1	47.1
70%:	47.0	47.0	46.9	46.8	46.8	46.7	46.6	46.5	46.5	46.4
80%:	46.3	46.3	46.2	46.1	46.1	46.0	46.0	45.9	45.9	45.8

90%:	45.7	45.7	45.6	45.5	45.4	45.3	45.1	44.9	44.8	44.7
100%:	44.2									


Exceedance Chart

S270_BIN030017_25082022_154806: Exceedance Chart

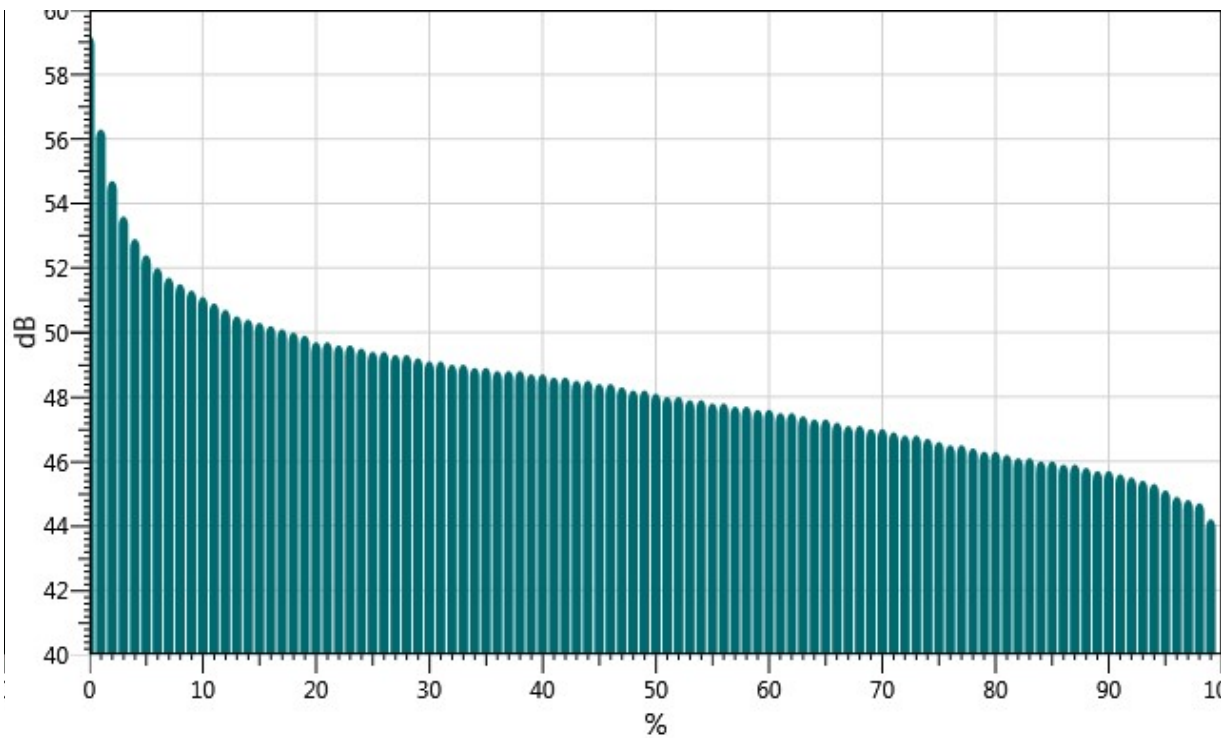

Logged Data Chart

S270_BIN030017_25082022_154806: Logged Data Chart

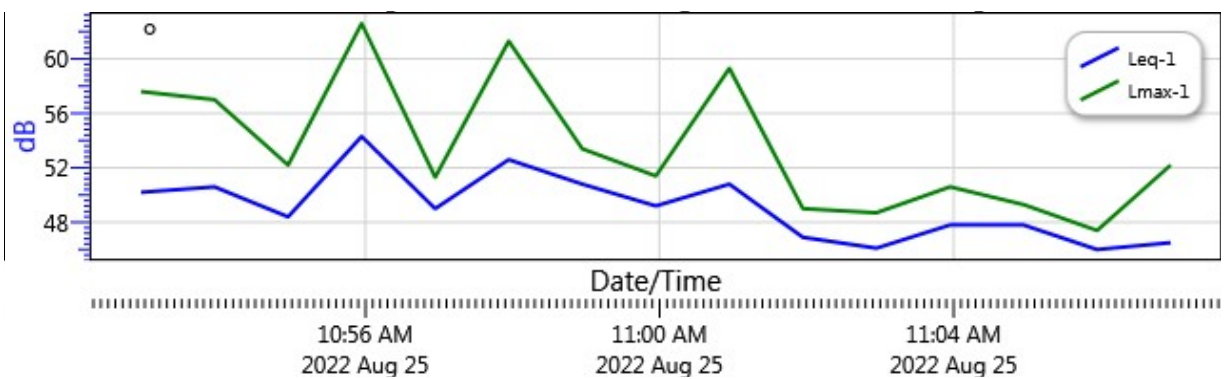



Noise Measurement Report Form - Part A

Date: 8/25/22 Day of Week: Thursday Time: 11:22am Project Number: 7187

Monitoring Segment / Area: 3 Monitoring Site Address: 12850 Muscatel St

Measurement Taken By: Michael / Erik of UltraSystems Environmental

Average Wind Speed: 4.8 mph [km/hr] Compass Heading (meter L to source) 282° W

Temp: 94.1 °F Relative Humidity: 31.7 % Compass Heading (into wind) 173° S

Cloud Cover Class (1 = heavy overcast, 2 = lightly overcast, 3 = sunny) 3

Approximate distance of sound level meter from receptor location: 74

Approximate distance of sound level meter from construction site: _____
(Leave Blank for Baseline Ambient)

Receptor Land Use (Check One): ☒ Residential ☐ Institutional ☐ Comm./Ind. ☐ Recreational

Sound Level Meter: Make and Model: Quest SoundPro DL-1-1/3 Serial Number: B710630017

Meter Setting: ☒ A-Weighted Sound Level (SLOW) ☐ A-Weighted Sound Level (FAST)

Measurement Start Time: 11:22am Measurement End Time: 11:37am

Total Measurement Time: 15 min Session File Name (e.g., S012): S271

Check the measurement purpose:

☒ Baseline condition ☐ Ongoing construction ☐ Caltrans ☐ Complaint response

Measurement Results

Measurement Type	Measured Levels (dB)	
Calibration	Pre: <u>114.0</u>	Post: <u>114.0</u>
L _{eq} (h)	Slow: <u>50.6</u>	Fast: _____
L _{max}	Slow: <u>62.8</u>	Fast: _____
L ₉₀	Slow: <u>47.5</u>	Fast: _____

Field Notes:

- Noise from school in distance
- Freeway noise from I-15
- _____

Noise Monitor's Signature: [Signature] Date: 8/25/22





Noise Measurement Report Form – Part B

Date: 08/25/22 Day of Week: Thursday Time: 11:22 am Project Number: 7187

Monitoring Segment / Area: 3 Monitoring Site Address: 12850 Muscatel St

Site Map

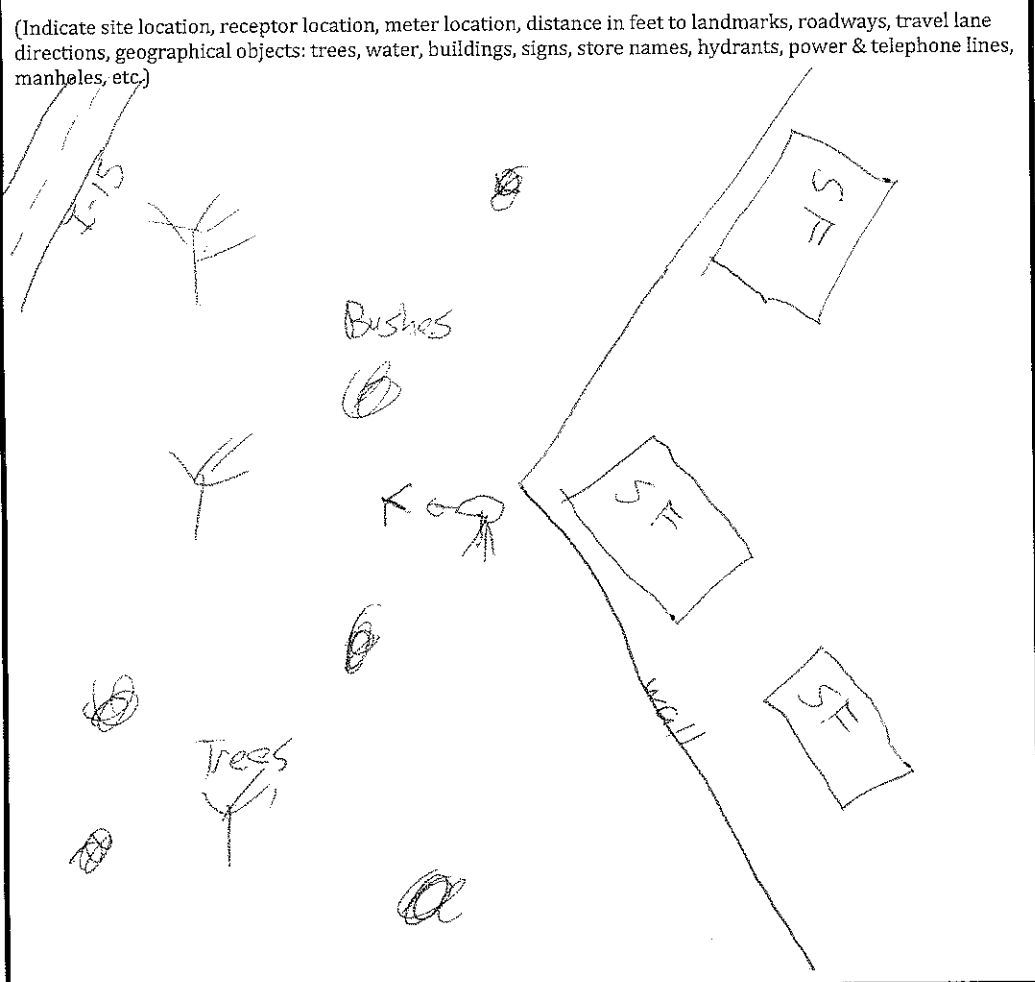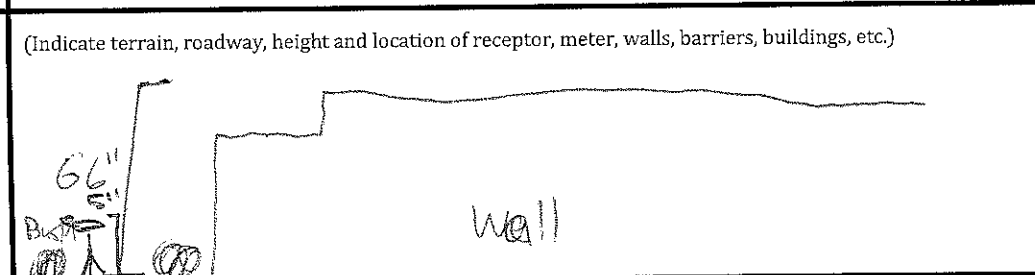Plan View  North Arrow (fill-in)	(Indicate site location, receptor location, meter location, distance in feet to landmarks, roadways, travel lane directions, geographical objects: trees, water, buildings, signs, store names, hydrants, power & telephone lines, manholes, etc.) 	
Elevation View	(Indicate terrain, roadway, height and location of receptor, meter, walls, barriers, buildings, etc.) 	
Latitude: <u>34.414718°</u>	Longitude: <u>-117.38163°</u>	Elevation: <u>3590ft</u>

Noise Monitor's Signature: [Signature]

Date: 08/25/22

Session Report

8/25/2022

Information Panel

Name	S271_BIN030017_25082022_154815
Start Time	8/25/2022 11:22:28 AM
Stop Time	8/25/2022 11:37:28 AM
Device Name	BIN030017
Model Type	SoundPro DL
Device Firmware Rev	R.13F
Comments	

Summary Data Panel

Description	Meter	Value	Description	Meter	Value
Leq	1	50.6 dB	L90	1	47.5 dB
Lmax	1	62.8 dB			
Exchange Rate	1	3 dB	Weighting	1	A
Response	1	SLOW	Bandwidth	1	OFF
Exchange Rate	2	5 dB	Weighting	2	C
Response	2	FAST			


Statistics Table

dB:	0.0	0.1	0.2	0.3	0.4	0.5	0.6	0.7	0.8	0.9	%
45:	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.04	0.04
46:	0.14	0.30	0.44	0.59	0.26	0.24	0.34	0.23	0.28	0.39	3.21
47:	0.50	0.79	0.84	1.05	1.38	1.34	1.39	1.38	1.40	1.53	11.59
48:	1.65	1.31	1.79	1.88	1.87	1.65	1.54	1.41	1.22	1.44	15.76
49:	2.51	1.90	2.16	1.73	1.91	1.91	1.83	1.84	1.74	2.19	19.73
50:	2.06	2.02	1.97	1.47	1.66	2.34	2.08	1.75	1.96	2.20	19.49
51:	2.00	2.03	1.56	1.51	1.68	1.90	1.69	1.23	1.16	1.18	15.95
52:	1.65	1.05	0.90	0.85	0.78	0.93	0.75	0.64	0.40	0.52	8.47
53:	0.57	0.47	0.36	0.34	0.28	0.20	0.18	0.14	0.17	0.11	2.81
54:	0.08	0.08	0.09	0.08	0.07	0.08	0.08	0.11	0.09	0.08	0.83
55:	0.08	0.07	0.05	0.07	0.09	0.11	0.09	0.08	0.11	0.07	0.82
56:	0.06	0.05	0.05	0.04	0.05	0.05	0.05	0.10	0.03	0.03	0.51
57:	0.04	0.03	0.07	0.02	0.01	0.01	0.02	0.04	0.04	0.02	0.29

58:	0.02	0.02	0.01	0.02	0.02	0.01	0.01	0.01	0.01	0.01	0.14
59:	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.09
60:	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.09
61:	0.01	0.02	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.11
62:	0.01	0.01	0.01	0.01	0.01	0.01	0.00	0.02	0.00	0.00	0.07

Statistics Chart

S271_BIN030017_25082022_154815: Statistics Chart

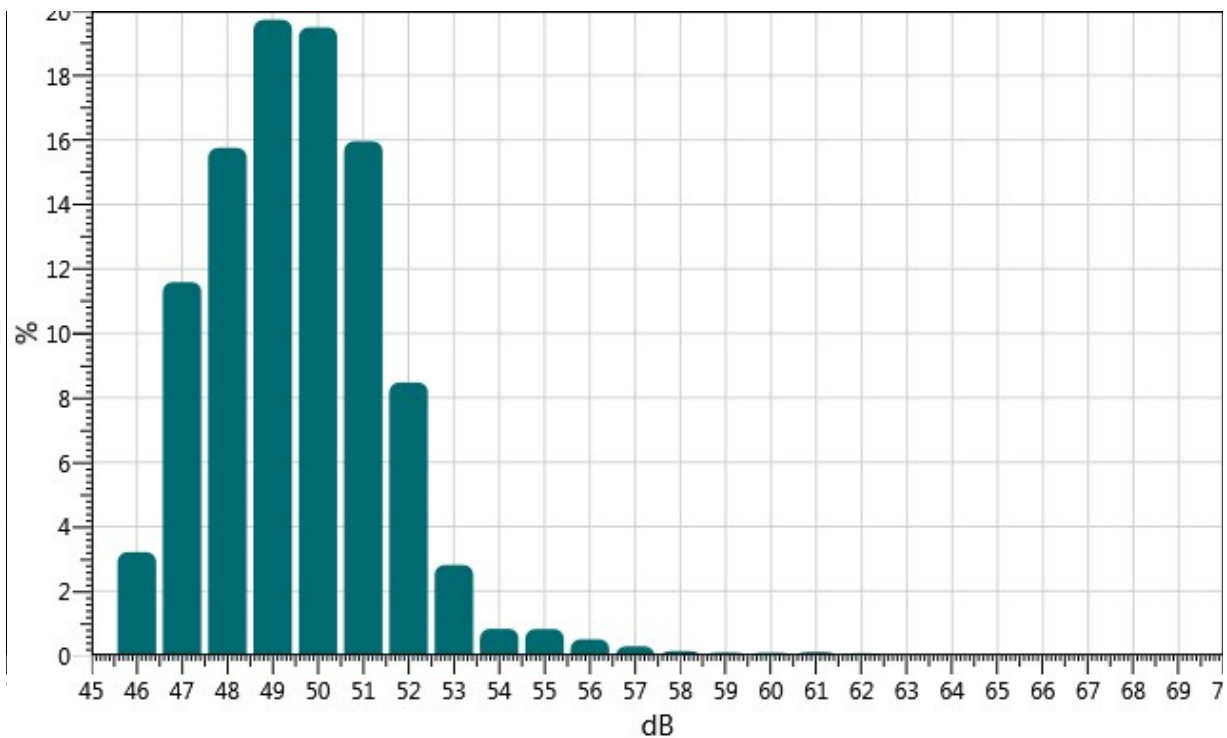


Exceedance Table

.	0%	1%	2%	3%	4%	5%	6%	%7	%8	%9
0%:		56.5	55.0	53.8	53.3	53.0	52.8	52.6	52.5	52.3
10%:	52.2	52.1	52.0	51.9	51.9	51.8	51.7	51.6	51.5	51.5
20%:	51.4	51.4	51.3	51.3	51.2	51.1	51.1	51.0	51.0	50.9
30%:	50.9	50.8	50.8	50.7	50.7	50.6	50.6	50.5	50.5	50.4
40%:	50.4	50.3	50.3	50.2	50.1	50.1	50.0	50.0	49.9	49.9
50%:	49.8	49.8	49.7	49.7	49.6	49.6	49.5	49.5	49.4	49.4
60%:	49.3	49.3	49.2	49.1	49.1	49.0	49.0	48.9	48.9	48.9
70%:	48.8	48.7	48.7	48.6	48.5	48.5	48.4	48.3	48.3	48.2
80%:	48.2	48.1	48.1	48.0	47.9	47.9	47.8	47.7	47.7	47.6
90%:	47.5	47.4	47.4	47.3	47.2	47.1	47.0	46.8	46.4	46.2

100%: 45.8


Exceedance Chart

S271_BIN030017_25082022_154815: Exceedance Chart

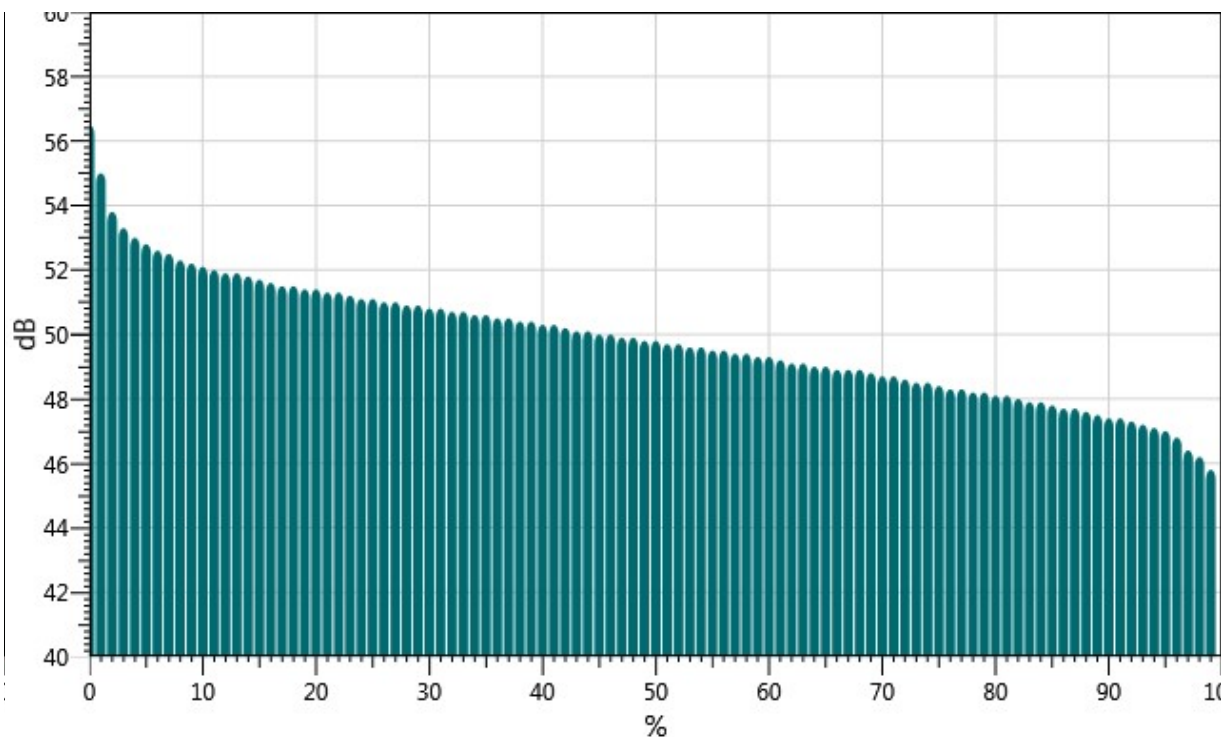

Logged Data Chart

S271_BIN030017_25082022_154815: Logged Data Chart

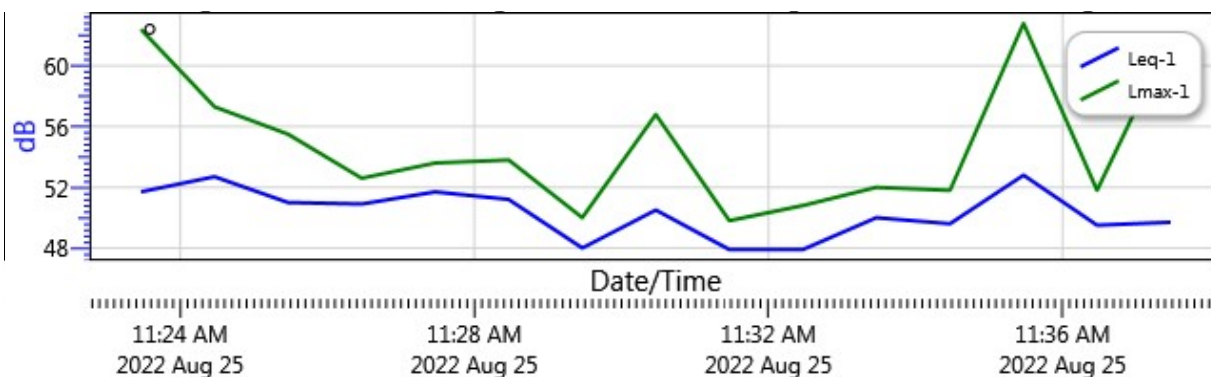



Noise Measurement Report Form - Part A

Date: 08/25/2022 Day of Week: Thursday Time: 12:38pm Project Number: 7187
Monitoring Segment / Area: 4 Monitoring Site Address: 9800 MESG Linda
Measurement Taken By: Michael / Erik of UltraSystems Environmental
Average Wind Speed: 3.2 mph [km/hr] Compass Heading (meter $\perp$ to source) 166° S
Temp: 76.2 °F Relative Humidity: 26.7 % Compass Heading (into wind) 210° SW
Cloud Cover Class (1 = heavy overcast, 2 = lightly overcast, 3 = sunny) 3
Approximate distance of sound level meter from receptor location: 62ft.
Approximate distance of sound level meter from construction site: _____
(Leave Blank for Baseline Ambient)
Receptor Land Use (Check One): ☒ Residential ☐ Institutional ☐ Comm./Ind. ☐ Recreational
Sound Level Meter: Make and Model: Quest SoundPro DL-1-1/3 Serial Number: BINO 30017
Meter Setting: ☒ A-Weighted Sound Level (SLOW) ☐ A-Weighted Sound Level (FAST)
Measurement Start Time: 12:38pm Measurement End Time: 12:53pm
Total Measurement Time: 15 min Session File Name (e.g., S012): S273
Check the measurement purpose:
☒ Baseline condition ☐ Ongoing construction ☐ Caltrans ☐ Complaint response

Measurement Results

Measurement Type	Measured Levels (dB)	
Calibration	Pre: <u>114.0</u>	Post: <u>114.0</u>
L _{eq} (h)	Slow: <u>71.5</u>	Fast: _____
L _{max}	Slow: <u>87.2</u>	Fast: _____
L ₉₀	Slow: <u>51.9</u>	Fast: _____

Field Notes:

1. Traffic Noise from Main St
2. _____
3. _____

Noise Monitor's Signature: [Signature]

Date: 08/25/22




Noise Measurement Report Form - Part B

Date: 08/25/22 Day of Week: Thursday Time: 12:38pm Project Number: 7187

Monitoring Segment / Area: 4 Monitoring Site Address: 9800 Mesa Linda

Site Map

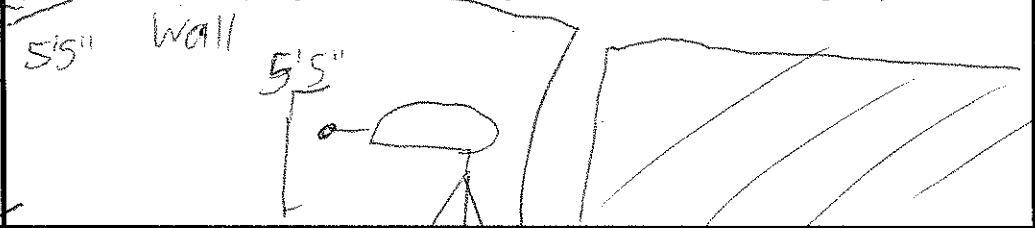Plan View  North Arrow (fill-in)	(Indicate site location, receptor location, meter location, distance in feet to landmarks, roadways, travel lane directions, geographical objects: trees, water, buildings, signs, store names, hydrants, power & telephone lines, manholes, etc.) 	
Elevation View	(Indicate terrain, roadway, height and location of receptor, meter, walls, barriers, buildings, etc.) 	
Latitude: <u>34.426887°</u>	Longitude: <u>-117.392436°</u>	Elevation: <u>3550</u>

Noise Monitor's Signature: [Signature]

Date: 08/25/22

Session Report

8/25/2022

Information Panel

Name	S273_BIN030017_25082022_154825
Start Time	8/25/2022 12:37:48 PM
Stop Time	8/25/2022 12:52:48 PM
Device Name	BIN030017
Model Type	SoundPro DL
Device Firmware Rev	R.13F
Comments	

Summary Data Panel

Description	Meter	Value	Description	Meter	Value
Leq	1	71.5 dB	L90	1	51.9 dB
Lmax	1	89.2 dB			
Exchange Rate	1	3 dB	Weighting	1	A
Response	1	SLOW	Bandwidth	1	OFF
Exchange Rate	2	5 dB	Weighting	2	C
Response	2	FAST			


Statistics Table

dB:	0.0	0.1	0.2	0.3	0.4	0.5	0.6	0.7	0.8	0.9	%
45:	0.00	0.02	0.02	0.11	0.06	0.14	0.18	0.22	0.18	0.22	1.15
46:	0.11	0.05	0.13	0.17	0.10	0.08	0.12	0.20	0.10	0.11	1.18
47:	0.15	0.16	0.16	0.09	0.14	0.17	0.11	0.14	0.13	0.16	1.42
48:	0.10	0.09	0.10	0.07	0.09	0.11	0.17	0.11	0.16	0.19	1.20
49:	0.20	0.10	0.10	0.10	0.10	0.14	0.13	0.13	0.10	0.08	1.16
50:	0.10	0.14	0.16	0.15	0.13	0.12	0.14	0.19	0.17	0.16	1.46
51:	0.13	0.14	0.17	0.29	0.31	0.22	0.30	0.24	0.20	0.30	2.29
52:	0.33	0.24	0.27	0.23	0.19	0.15	0.13	0.15	0.20	0.19	2.08
53:	0.24	0.38	0.35	0.29	0.22	0.17	0.19	0.13	0.14	0.23	2.35
54:	0.16	0.11	0.09	0.10	0.14	0.12	0.11	0.14	0.16	0.27	1.39
55:	0.20	0.14	0.09	0.12	0.11	0.12	0.11	0.11	0.11	0.10	1.20
56:	0.12	0.13	0.10	0.11	0.11	0.08	0.09	0.08	0.10	0.10	1.03
57:	0.10	0.10	0.12	0.16	0.15	0.12	0.14	0.09	0.11	0.13	1.21

58:	0.13	0.14	0.10	0.27	0.21	0.15	0.14	0.12	0.18	0.14	1.57
59:	0.15	0.17	0.15	0.17	0.17	0.20	0.31	0.34	0.28	0.29	2.23
60:	0.22	0.17	0.16	0.15	0.20	0.20	0.23	0.19	0.27	0.24	2.03
61:	0.24	0.27	0.13	0.22	0.19	0.20	0.18	0.17	0.15	0.15	1.90
62:	0.17	0.19	0.26	0.22	0.17	0.21	0.23	0.26	0.19	0.23	2.12
63:	0.19	0.19	0.22	0.22	0.28	0.28	0.27	0.26	0.25	0.33	2.49
64:	0.30	0.41	0.22	0.26	0.26	0.27	0.29	0.31	0.33	0.32	2.97
65:	0.31	0.35	0.30	0.40	0.37	0.53	0.51	0.43	0.47	0.38	4.05
66:	0.37	0.40	0.40	0.43	0.46	0.49	0.50	0.48	0.52	0.54	4.59
67:	0.52	0.60	0.40	0.62	0.47	0.46	0.53	0.50	0.47	0.43	5.00
68:	0.57	0.61	0.69	0.57	0.56	0.56	0.55	0.48	0.50	0.50	5.59
69:	0.60	0.53	0.56	0.64	0.87	0.80	0.78	0.85	0.68	0.75	7.06
70:	0.72	0.71	0.52	0.63	0.66	0.67	0.66	0.65	0.60	0.72	6.54
71:	0.66	0.85	0.70	0.61	0.62	0.63	0.55	0.53	0.54	0.53	6.22
72:	0.70	0.62	0.57	0.59	0.50	0.56	0.60	0.65	0.65	0.65	6.09
73:	0.74	0.76	0.57	0.72	0.78	0.79	0.66	0.65	0.62	0.64	6.93
74:	0.53	0.54	0.53	0.58	0.48	0.48	0.27	0.31	0.35	0.28	4.35
75:	0.39	0.36	0.34	0.60	0.36	0.32	0.42	0.37	0.46	0.36	3.98
76:	0.28	0.20	0.11	0.14	0.15	0.24	0.23	0.22	0.25	0.27	2.10
77:	0.31	0.23	0.19	0.13	0.12	0.09	0.05	0.05	0.06	0.07	1.31
78:	0.10	0.08	0.04	0.05	0.05	0.06	0.04	0.03	0.03	0.03	0.51
79:	0.04	0.09	0.02	0.01	0.01	0.02	0.02	0.02	0.02	0.02	0.27
80:	0.02	0.02	0.02	0.03	0.08	0.01	0.01	0.01	0.01	0.01	0.22
81:	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.09
82:	0.01	0.01	0.01	0.00	0.01	0.01	0.01	0.01	0.01	0.01	0.08
83:	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.08
84:	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.08
85:	0.01	0.01	0.01	0.00	0.01	0.01	0.01	0.01	0.01	0.01	0.09
86:	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.09
87:	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.01	0.10
88:	0.01	0.02	0.02	0.01	0.01	0.03	0.01	0.01	0.01	0.01	0.14
89:	0.01	0.02	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.02

Statistics Chart

S273_BIN030017_25082022_154825: Statistics Chart

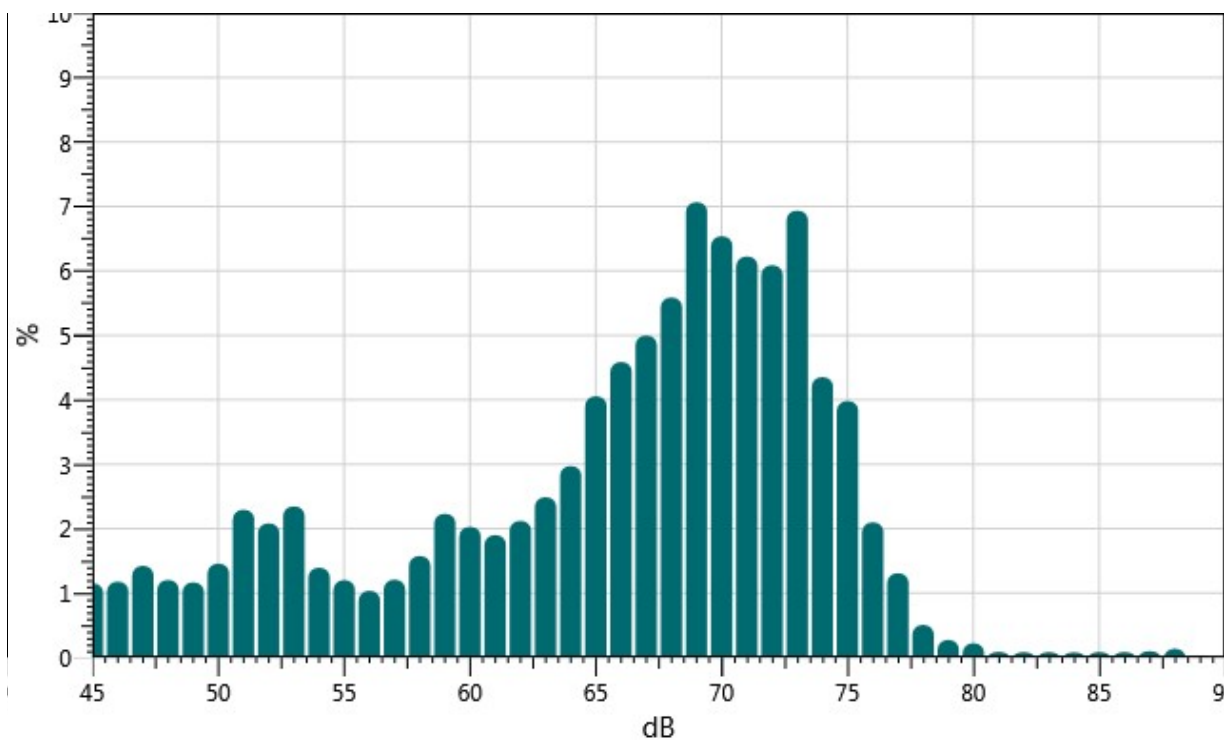


Exceedance Table

.	0%	1%	2%	3%	4%	5%	6%	%7	%8	%9
0%:		79.8	77.5	76.9	76.5	75.9	75.6	75.4	75.2	74.9
10%:	74.6	74.3	74.1	73.9	73.8	73.6	73.5	73.3	73.2	73.0
20%:	72.9	72.8	72.6	72.4	72.3	72.1	71.9	71.8	71.6	71.4
30%:	71.2	71.1	71.0	70.8	70.7	70.5	70.4	70.2	70.0	69.9
40%:	69.8	69.6	69.5	69.4	69.3	69.1	68.9	68.7	68.5	68.3
50%:	68.2	68.0	67.8	67.6	67.4	67.2	67.0	66.8	66.6	66.4
60%:	66.2	66.0	65.7	65.5	65.3	65.0	64.7	64.4	64.0	63.7
70%:	63.3	62.9	62.4	61.9	61.3	60.9	60.4	59.9	59.5	59.0
80%:	58.4	57.8	56.9	55.9	55.0	54.4	53.7	53.2	52.9	52.3
90%:	51.9	51.5	51.1	50.5	49.7	48.9	48.1	47.3	46.6	45.8
100%:	44.9									

Exceedance Chart

S273_BIN030017_25082022_154825: Exceedance Chart

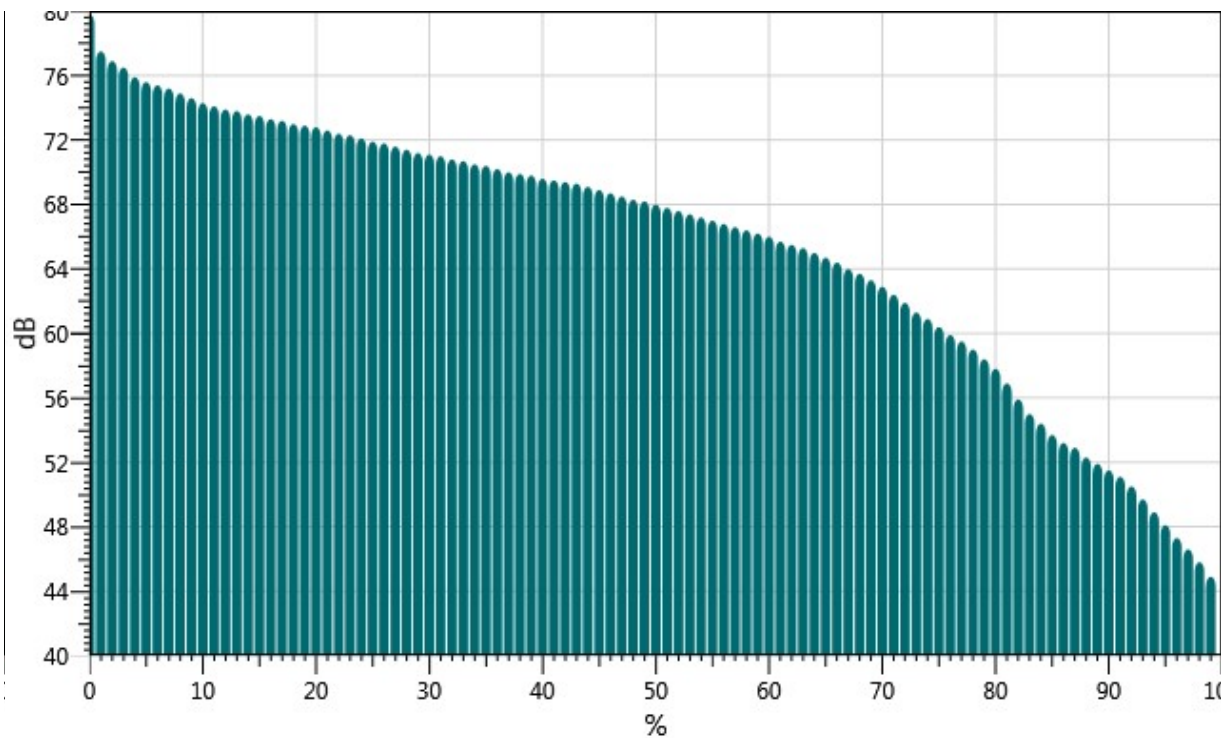

Logged Data Chart

S273_BIN030017_25082022_154825: Logged Data Chart

